

Work Order ID 106076

106076

Page 1

August-28-13 12:40:47 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Crosstube - High

Start Date: 8/28/13 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 8/28/13 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: MLJ Date: 13-08-29 Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start *NR1*
Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D412-664-243	E/DEO								

100 DOCUMENT CONTROL

0.00

100

DAS
06
8-28

13/07

MLJ

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D412-664-203 CHG 009

110 Packaging

0.00

110

Rm

13-09-12

Packaging

Memo

0.00

Packaging

Pho →

120 BENDING MACHINE - CROSSTUBES

0.00

120

JW

13-09-18

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D412-664-243 using CNC bender program 412-aft and Folio FT010

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: John Date: 13/10/17

QA Closed:

Date:

Work Order: <u>106076</u>	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS			
Part No. <u>D412-664-203</u>		Skid-tube <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>
NCR No. <u>13-3117</u>		Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>
		Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>
		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>	13/4/18	120	1	CRUSHING IS OVER TOLERANCE	CP 13/4/18	Acceptable REF Attached S.R.	CP 13/4/18	DAS 16 9-89 13/07/18	DAS 16 9-89 13/07/18
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input checked="" type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input checked="" type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	---	---	--	---

Work Order ID 106076

106076

Page 2

August-28-13 12:40:47 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 8/28/13

Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/28/13

Req'd Qty: 1.00

1

Customer:

Reference:

Run Start

NR1

Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop

NR2

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

130

QC15- Crosstube Dimensional Check

0.00

130

QC

Memo

0.00

DAS

16

9-89

13/09/13

Quality Control

140

0.00

140

Crosstubes

Crosstubes

Memo

0.00

1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551 and drill table DT8577 using #9 holes as per QSI 10 to install towers.

2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-SCRIBE PART # & BATCH #

4- *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE *** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243

Rm

13-09-18

AB / Rm

13-09-18

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
---	---	---

☐ Ovalized
☐ Over/Under tolerance
☐ Part Incorrect
☐ Part Lost/Missing
☐ Part Moved
☐ Positioned Wrong
☐ Power Loss/Surge

☐ Pressure/Forced
☐ Temperature/Cure
☐ Weld
☐ Wrong Stock Pulled
☐ Other

Work Order ID 106076

106076

Page 3

August-28-13 12:40:47 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 8/28/13

Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/28/13

Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run

Start

NR1

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00				1			<i>13-09-19</i>
160									
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
170		0.00				1	0	0	<i>13-9-19</i>
170									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- CLEAN CROSSTUBE WITH WASH'N WIPE								
180	Outsource process - NDT per QSI038 4.1	0.00							<i>13/09/19</i>
180									
Outsource2	Memo	0.00							
Outsource process - NDT	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Liquid Penetrant Inspection as per QSI 038Or								
	Issue P/O <i>21414</i> LPI as per ASTM 1417								
	Level 2 Attach copy of NDT results to work order								

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
---	---	---

<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	---

Work Order ID 106076

106076

Page 4

August-28-13 12:40:47 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 8/28/13

Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/28/13

Req'd Qty: 1.00

1

Customer:

Reference:

Run Start

NR1

Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop

NR2

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

190

190

Packaging

Packaging

Packaging

Memo

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

Inspect for transit damage

Ensure copy of NDT results attached to work order.

0.00

0.00

200

200

QC

Quality Control

QC5- Inspect part completeness to step on W/O

Memo

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

Inspect for damage & ensure results are as per Dwg D412-664-203

0.00

0.00

203

203

HandFXtube

Hand Finishing Crosstubes

Memo

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN CROSSTUBE BEFORE CHEMICAL CONVERSION

0.00

13/7/13

13-09-19

13-9-19

DU

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	---	--	---

Work Order ID 106076

106076

Page 5

August-28-13 12:40:47 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 8/28/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 8/28/13 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

205

QC7-Inspect Chemical Conversion Coat

0.00

205

QC

Memo

0.00

Quality Control

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

1 

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
FAULT CATEGORY											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		

Work Order ID 106076

106076

Page 6

August-28-13 12:40:47 PM

Item ID: D412-664-203

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 8/28/13

Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/28/13

Req'd Qty: 1.00

1

Customer:

Reference:

Run Start

NR1

Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop

NR2

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

210

0.00

210

SprayPaint

0.00

SprayPaint

Memo

Spray Painting

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

Mask underside of crosstube as shown

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per DEO D412-664-243 and QSI 005 4.2

PRIME: 126673

Start Time: 1:15

Finish Time: 1:45

PAINT: 126667

Start Time: 8:15

Finish Time: 8:45

3- Apply clear coat after paint as per DEO

126556

1 0 0 AS 13-9-24

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Work Order ID 106076



106076

Page 7

August-28-13 12:40:47 PM

Item ID: D412-664-203 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Aft Crosstube - High
 Start Date: 8/28/13 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 8/28/13 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220 *220* QC Quality Control	QC14- Inspect Spray Paint Memo Then, Wrap in plastic bag to protect from scratches	0.00 0.00				1			 13-09-25
230 *230* Crosstubes Crosstubes	Crosstubes Memo Assemble as per Dwg D412-664-203 1- Install chafing shield as per DEO D412-664-243. Top holes should be facing up. A/R Proseal 890 Batch: <u>126010</u> EXP: <u>2/14</u> 2- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe 3- Install support with Scotch-Weld DP460 and install clamps as per DEO Dwg D12-664-243 using installation jig DT9024. Torque clamps as per dwg A/R Scotch-Weld DP460 Batch: <u>126328</u> EXP: <u>7/14</u>	0.00 0.00				1	0	0	 13-10-3

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
---	---	---

<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	---

August-28-13 12:40:47 PM

106076

Page 8

Accept

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 8/28/13 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 8/28/13 **Req'd Qty:** 1.00 *** 1 ***

Customer:

Reference:

Run Start *NR1*

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Stop *NR2*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

240

QC5- Inspect part completeness to step on W/O

0.00

240

QC

Memo

0.00

Quality Control

***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED
FOR 24HOURS AS PER DWG.***

250

Pick Kit

0.00

250

Packaging

Memo

0.00

Packaging

260

QC4- 100% Inspect kits for completeness

0.00

260

QC

Memo

0.00

Quality Control

100-443886-100

13/10/18

7

DA
33
89 13-10-04

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabelled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 106076

106076

Page 9

August-28-13 12:40:47 PM

Item ID: D412-664-203

Accept

N9000040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Crosstube - High

Start Date: 8/28/13 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 8/28/13 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

270

0.00

270

Packaging

Packaging

Memo

0.00

Identify and pack for shipping as per PPP D412-664-203

*****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27

for application time & date *****

Time & date of packaging: _____

Location: 102

DAS

6

9-89

9-89
6
DAS

1 8 13-10-9

280

QC21- Final Inspection - Work Order Release

0.00

280

QC

Memo

0.00

Quality Control

13/13-10-7

13-10-9

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Picklist Print

August-28-13 12:40:47 PM

Page 1

Work Order ID: 106076
 Parent Item: D412-664-203
 Parent Item Name: Aft Crosstube - High

Start Date: 8/28/13

Required Date: 8/28/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:E04.02.16Reformat; Added D3189-1K/DS
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
 IPP Rev:G 06.12.08 per ECN 886 EC
 IPP Rev:H 07-04-30 As per Rev D JLM
 IPP Rev:I 08-06-12 add comment in seq. 21 DD verified by:EC IPP rev J 11.04.21 DEO D412-664-243-E-1 EC verified DD IPP REV:K 11.10.03 DEO D412-664-243-E-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D412-664-203TRN
 Crosstube Turning Detail

Manufactured No

110

Each

11.0000

1

1

Location

Loc Qty

Loc Code

LG

105234

10

102784

1

104706

1

104707

1

104708

1

104709

1

105227

1

105228

1

105232

1

96406

1

96775

1

LG003

1

105230

1

Rm

13-09-12

D2896-1
 Support

Manufactured No

230

Each

41.0000

1

1

A8 13-10-3

Location

Loc Qty

Loc Code

LG053

41

103376

20

74465

8

96821

13

①

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Picklist Print

August-28-13 12:40:47 PM

Page 2

Work Order ID: 106076
Parent Item: D412-664-203
Parent Item Name: Aft Crosstube - High

Start Date: 8/28/13

Required Date: 8/28/13

Start Qty: 1.00

Required Qty: 1.00

D3189-1
Chaffing Shield

Manufactured No

230 Each 63.0000

2

2

AS 13-10-3

Location	Loc Qty	Loc Code
107498		
FG	4	
36065	4	
LG	20	
104462	20	
LG052	20	
102314	20	
LG053	19	
103375	10	
89901	4	
99911	5	

②

D3595-063-570
Rubber Cushion

Manufactured No

230 Each 124.0000

2

2

AS 13-10-3

Location	Loc Qty	Loc Code
FG	10	
42243	10	
LG051	71	
71534	1	
76546	2	
83294	13	
95262	55	
LG055	43	
92940	43	

②

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	---	--	---

Picklist Print

August-28-13 12:40:47 PM

Work Order ID: 106076
 Parent Item: D412-664-203
 Parent Item Name: Aft Crosstube - High

Start Date: 8/28/13

Required Date: 8/28/13

Start Qty: 1.00

Required Qty: 1.00

MS21920-28 Purchased No 230 Each 137.0000 4 4 AB 13-10-3

Clamp

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	5	
105884	5	
LG	1	
M125728	1	
LG050	120	
123674	10	
124505	4	
125351	8	
M126085	50	(4)
M126292	48	
LG051	11	
121440	8	
123243	2	
124260	1	

MS21920-30 Purchased No 230 Each 165.0000 2 2 AB 13-10-3

Clamp

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
LG050	151	
119529	1	
123240	5	
124624	45	(2)
m126336	50	
m126453	50	
LG051	14	
111258	14	

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
---	---	---

<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	
--	---	--

Picklist Print

August-28-13 12:40:47 PM

Page 4

Work Order ID: 106076
Parent Item: D412-664-203
Parent Item Name: Aft Crosstube - High

Start Date: 8/28/13

Required Date: 8/28/13

Start Qty: 1.00

Required Qty: 1.00

AN6-40A
Bolt

Purchased No

250 Each 146.0000

4 4 33 88

Location	Loc Qty	Loc Code
ST340	20	
M126105	20	
ST517a	126	
124561	1	
125388	75	
M126010	50	

AN6-41A
Bolt

Purchased No

250 Each 92.0000

2 2 33 88

Location	Loc Qty	Loc Code
ST504	50	
M126180	50	
ST517	42	
125388	42	

AN960JD616
Washer

NAS1149D0663J Purchased

No

250 Each 0.0000

18 18 33 88

MS21042L6
Nut

Purchased No

250 Each 353.0000

6 6 33 88

Location	Loc Qty	Loc Code
ST314	353	
123248	7	
125535	146	
m126275	200	

126275

August-28-13 12:40:47 PM

Shop Packet Print

Page 4

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Required Dimension	Min	Max
Height	24.24	24.50
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70
Bending Passes	8	--
Crushing	--	6%

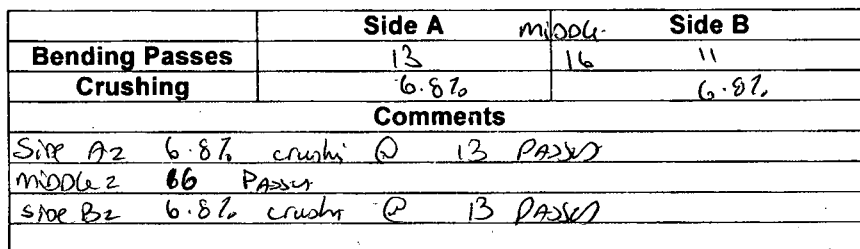

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. D	KJ/JLM	
C	10.02.02	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	

Item	Qty	Part Number	Description
	-243		
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 47.0 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOW COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 106076 MJS


130829

② DEO ATTACHED


RELEASED
2009-10-29

E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087. ADD D2732-058 & MAGNOBOND 6398. MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	QP	DRAWING NO.	REV. E
MFG. APPR.	DS	D412-664-243	SHEET 1 OF 4
APPROVED	102	TITLE	SCALE
DE APPR.	11	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


106076

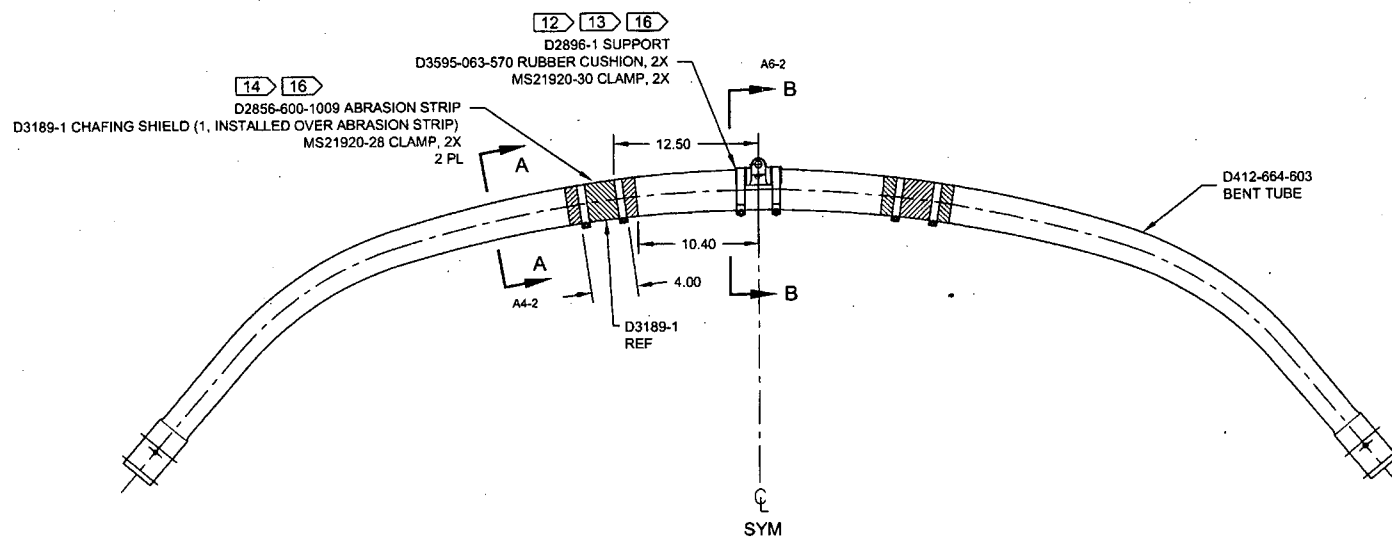

D212-664-243
ASSEMBLY DETAIL

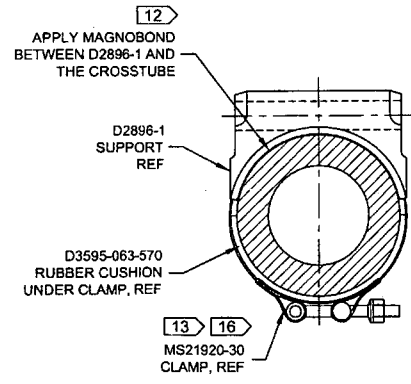

SECTION B-B D4-2
SCALE 4X

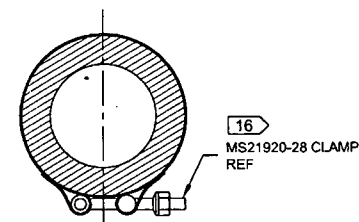


SECTION A-A C6-2
SCALE 4X

2 DEO ATTACHED


RELEASED
2009-10-28
NRP

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PS	DRAWING NO.	REV. E
MFG. APPR.	PS	D412-664-243	SHEET 2 OF 4
APPROVED	PS	TITLE	SCALE
DE APPR.	PS	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


106076

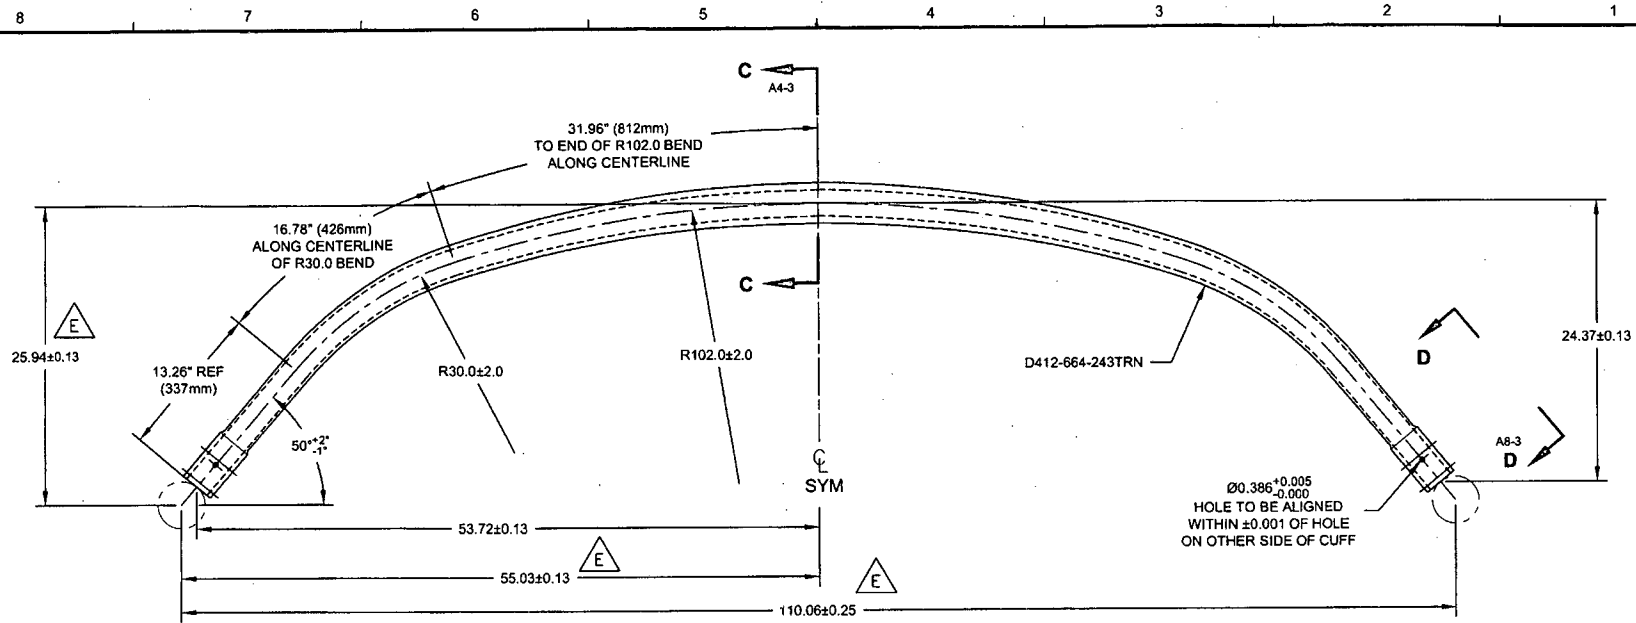

D412-664-603 10
BENDING AND DRILLING DETAIL E

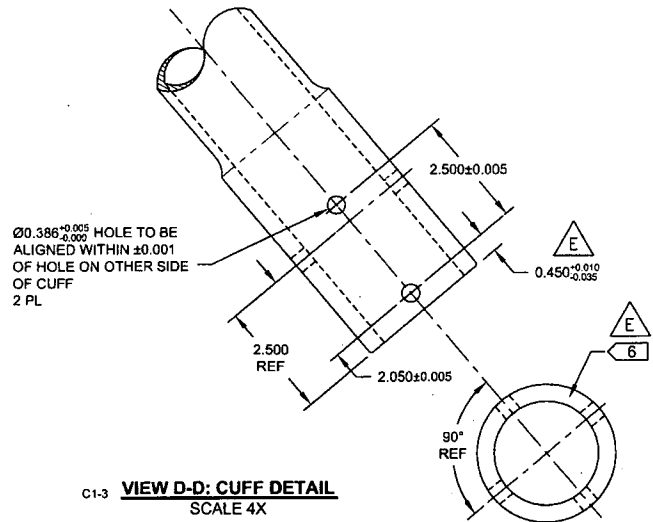

C1-3 **VIEW D-D: CUFF DETAIL**
SCALE 4X


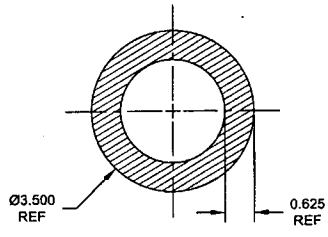


SECTION C-C D5-3
SCALE 4X



DEO ATTACHED
RELEASED
2009-10-29
MP

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PS	DRAWING NO.	REV. E
MFG. APPR.	SS	D412-664-243	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	TH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

106076

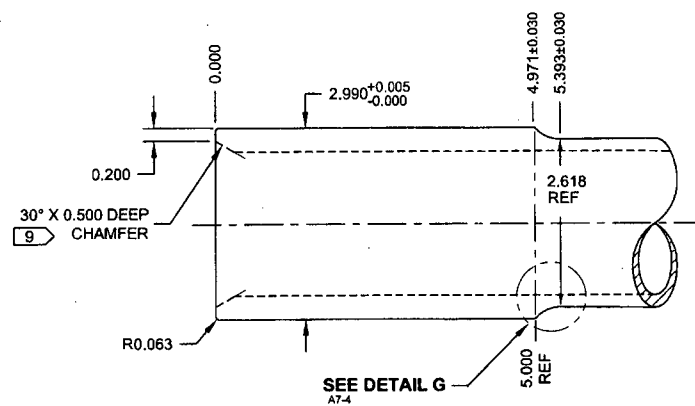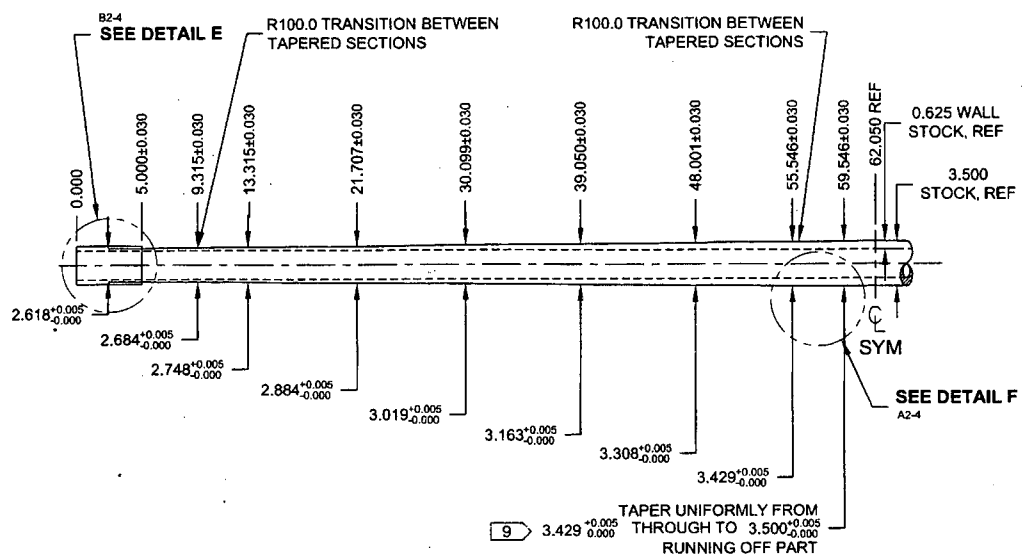

D412-664-243TRN
TURNING DETAIL

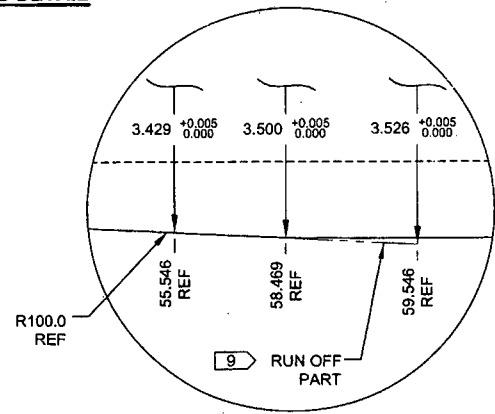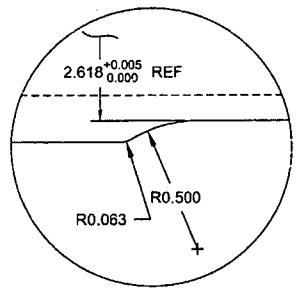

2 DEO ATTACHED

RELEASED

2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. E
MFG. APPR.	DS	D412-664-243	SHEET 4 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	14	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

106076

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASS'Y (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN MP	CHECKED ASS	MFG. APPR. E	APPROVED MP		DE APPR. #		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -243	Part Number	Description
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 16, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MP

106076

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 1 OF 3	SCALE NTS
DRAWN 92	CHECKED A	MFG. APPR. A	APPROVED MP		DE APPR. MP		
DATE 12.08.21	DATE 12.08.30	DATE 12.08.30	DATE 12/8/30		DATE 12.08.30		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890. UPDATE INSTALLATION OF CHAFING SHIELDS AND REDUCE TORQUE TO 40-50 IN-LBS. THIS ENGINEERING ORDER SUPERCEDES DEO D412-664-243-E-1.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

WAS:

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2, 14, AND 16 ON SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 16) TORQUE CLAMPS ON D2896-1 SUPPORT 80 TO 100 IN-LB. **TORQUE CLAMPS ON D3189-1 CHAFING SHIELD 40 TO 50 IN-LB.** ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
R 2012-09-04

MP

106 076

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 2 OF 3	SCALE NTS
DRAWN 92	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 12.08.21	DATE 12.08.27	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29		

IS:

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)
MS21920-28 CLAMP, 2X
2 PL

D412-664-603
BENT TUBE

11.83
TO CLAMP
11.60
TO
CHAFING
SHIELD
4.00
CLAMP SPACING
4.38
CHAFING SHIELD, REF
2.00
1.00

WAS:

D2856-600-1009 ABRASION STRIP
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)
MS21920-28 CLAMP, 2X
2 PL

D3189-1
REF

**D412-664-243
ASSEMBLY DETAIL**

2
MASK AREA PRIOR TO PAINTING AND
APPLY CLEAR COAT AFTER PAINTING

2.00


Q
SYM

RELEASE
2012-09-04
U

COPYRIGHT © 2012 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

106076

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 3 OF 3	SCALE NTS
DRAWN 97	CHECKED 1	MFG. APPR. AA	APPROVED MP	DE APPR. H		
DATE 12.08.21	DATE 12.08.22	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29	

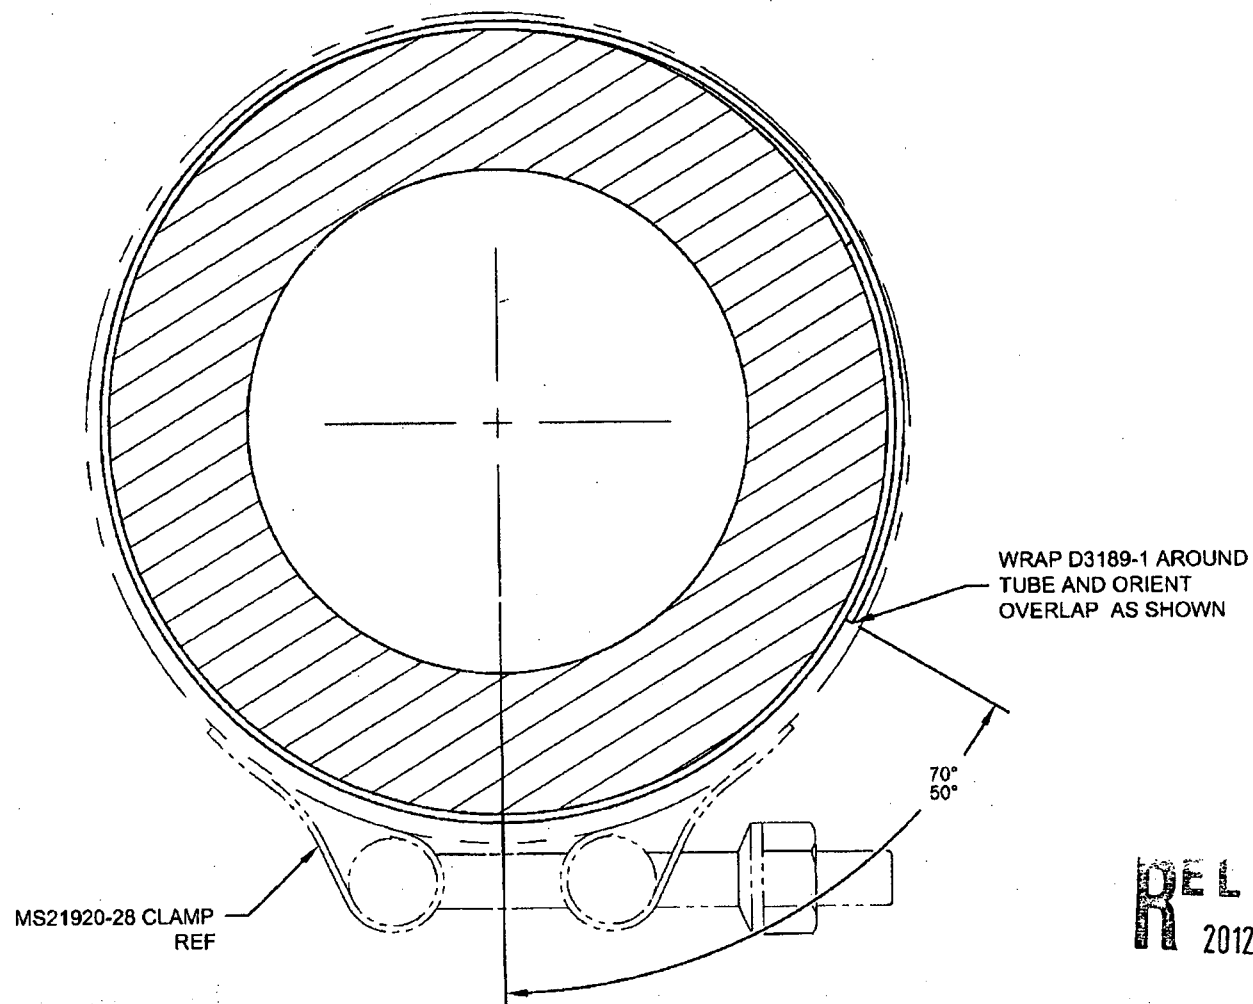

SECTION A-A
CHAFING SHIELD DETAIL
VIEW ROTATED, NOT TO SCALE

RELEASED
2012-09-04
MP

COPYRIGHT © 2012 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

412-664-203 Crosstube

BATCH:

Setup:

3.5" rollers for middle bend
-side bends use 3.375 rollers

*******MAKE SURE TOWERS ARE AT CORRECT HEIGHT BEFORE DOING INITIAL APPROACH*******

Lines:

29" & 32" from Centerline & 22.25" from cuffs.

Middle Bend

(buggy A 1.75" on cuff)

3.5" Rollers.run prog (odd#'s) M1-3-5-7-9-11-13 CHECK. Run 14,15,16 **AS REQUIRED**, to bend middle. Bend both tubes of Kanban before changing rollers to 3.375"

Approach is **2900** on both rollers, starting @ 32" line on tube with longer end of tube on **LARGE TABLE**.

NOTE: Check middle bend on the board that is down (not bender table board),reference lines **MUST** match up with tangent lines if not the side bends will not work properly. (Hand made ref. line on board 412)

Side bends

(buggy A 1.75" on cuff) **LARGE TABLE**

After changing rollers, start program run 412-side 1 to 5 from 29"line. **Y @ 1820 & W @ 3730** approaches for program 10 (up taper sets itself automatically on 22.25 line. Run program 10 and 12 up taper, repeat on second side then check. must reset approaches for each up taper program from this point on. **Y3500 W3730**.

Run additional programs as required to finish tube.

NOTES

-12/3/1 working with middlefix program to even out sides. after completely running middle programs, (up to 15) ran middlefix program with under bent side on large table, from centre line. we had a difference of about .100" between the two sides before running. afterwards we had two perfect matching measurements for middle bend. approach for middle program was **W2855/3095Y**.

-13/01/24... middle bend (1,3,5,7,9,11,13).....sides 1,2,3,4,5,10,12 CHECK ..run 14,16,18 etc. as needed checking between each program! MO

PASSES:

Handwritten notes and numbers:

MAT

1	3	7
2	5	8
3	7	9
4	9	10
5	11	12
10	13	14
12	14	16
14	16	18
16	18	19
18	19	20


11-11-73

11(1)

11.12.06

CRUSHING OF D412-664-243

Acceptability of 8% CRUSHING AT END OF BEND

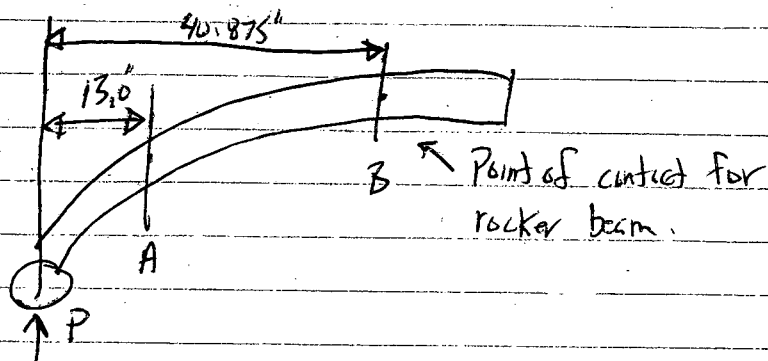Point A: $OD_1 = 2.961"$, $OD_2 = 2.522"$

$$CRUSHING = (2.961 - 2.522) / (2.961 + 2.522) = 8\%$$

$$I = 1.676 \text{ in}^4 \text{ (from AutoCAD)}$$

Point B: $OD_1 = 3.307"$, $I = 4.613 \text{ in}^4$

$$A: F = M_c / I = P \times 13 \times 2.961 / 2 \times 1.676 = 11.484 \cdot P$$

$$B: \quad \quad \quad = P \times 40.875 \times 3.307 / 2 \times 4.613 = 14.651 \cdot P$$

$$M.S. = 14.651 / 11.484 - 1 = 0.27$$

∴ Tube will break at rocker beam contact before area of 8% crushing, 8% crushing in area at end of tube bend is acceptable

P 11.12.06

Hilary





LIQUID PENETRANT TEST REPORT

P- 15349

CLIENT
ATTENTION
ADDRESS

DART AEROSPACE
ANDY SHELTON
1270 ABENDEEN RD
HAWKESBURY, ON

DATE

SEP-19/13

PAGE 1 OF 1

TIME AM ☒ PM ☐

ACUREN JOB NO.

188-13-CO174

PO/WO NO.

21414

WORK LOCATION

SAME

ACCEPTANCE STD.

ASTM 1417/01-038

REV./DATE 2005

PROJECT

F.P.I. ON CROSS TUBES

ITEM(S) EXAMINED

JOB DESCRIPTION

PROCEDURE NO. LT-xxxx REV./DATE

TECHNIQUE NO. LT-xxxx-xxx REV./DATE

PART NO.

SEE RESULTS

MATERIAL

ALUMINUM

THICKNESS

VARIOUS

SCOPE

A WET FLUORESCENT DYE INSPECTION WAS COMPLETED ON THE 100% OF THE SURFACE ONLY.

TEST DETAILS

METHOD

☒ FLUORESCENT

☐ VISIBLE

☒ WATER WASH

☐ SOLVENT REMOVABLE

☐ POST EMULSIFIED

FAMILY BRAND

MENAFLEX

BLACK LIGHT S/N 10454

☐ OUTPUT > 1000 μ W/cm²

☐ AMBIENT < 2 fc

PENETRANT

2LG7

MINIMUM DWELL TIME 45 MIN.

LIGHTING EQUIP.

☐ FLASHLIGHT

☐ TROUBLELIGHT

☐ OUTPUT > 100 fc @ SURFACE

PENETRANT REMOVER

H2O

MINIMUM DRY TIME > 10 MIN.

OTHER

LAB 10

DEVELOPER

SKD 82

MINIMUM DWELL TIME 10 MIN.

LIGHT METER S/N

CAL DUE DATE

DEVELOPER TYPE

☒ NON AQUEOUS

☐ AQUEOUS

☐ DRY

TEST SURFACE

SURFACE CONDITION

☐ AS GROUND

☐ AS WELDED

☒ MACHINED

☐ SHOT BLASTED

☒ CLEAN BARE METAL

SURFACE TEMPERATURE

☐ < -4°C/ 20°F

☐ -4°C/ 20°F TO 10°C/ 50°F

☒ 10°C/ 50°F TO 52°C/ 125°F

☐ > 52°C/ 125°F

RESULTS-

☐ METRIC ☒ IMPERIAL

ITEM

COMMENTS

ACCEPT

REJECT

1

CROSSTUBE, W.O. #

1

106070

1

106736

1

106732

1

106733

1

106734

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

1

106735

SIGNATURES

CLIENT REPRESENTATIVE

Andy Sheldon

PRINT

Sheldon

SIGNATURE

DTR #

E20825

TECHNICIAN (SIGNATURE):

NAME (PRINT):

Mike H. H. H.

1ST TECHNICIAN

2ND TECHNICIAN

CGSB LEVEL

SNT LEVEL

CGSB LEVEL

SNT LEVEL

CGSB REG. NO.

6606

CGSB REG. NO.

REPORT

REVIEWED BY:

NAME

INITIALS

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY

Work Order ID 106076

August-28-13 12:40:47 PM

106076

Page 1

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Crosstube - High

Start Date: 8/28/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/28/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: *MCS*

Date: 13-08-29 Tooling:

Date:

Run Start *NR1*

QC:

Date: SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D412-664-243

E/DEO

100

100

DC

Document Control

DOCUMENT CONTROL

Memo

Photocopy bluefile and create labels as per PPP D412-664-203 CHG 009

0.00

0.00

MCS 13-10-07

110

110

Packaging

Packaging

Packaging

Memo

0.00

0.00

RM 13-09-12

120

120

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo

Bend tube as per Dwg D412-664-243 using CNC bender program 412-aft and Folio FT010

0.00

0.00

JW 13-09-18

Plz ->

5.0 PARTS LIST

REFERENCE ONLY

5.1 HIGH GEAR CROSSTUBES

Item	-101	-201	-203	Part Number	Description
	X			D212-664-101	CROSSTUBE INSTALLATION, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
		X		D212-664-201	CROSSTUBE INSTALLATION, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
			X	D412-664-203	CROSSTUBE INSTALLATION, 412 HIGH AFT
1	1			D212-664-141	CROSSTUBE ASSEMBLY, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
2		1		D212-664-241	CROSSTUBE ASSEMBLY, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
3			1	D412-664-243	CROSSTUBE ASSEMBLY, 412 HIGH AFT
10	2			* D2893-1	SUPPORT
11	4			* D3595-063-450	RUBBER CUSHION
12	4			* MS21920-25	CLAMP (OR MS21042-26)
13	4			AN6-35A	BOLT
14	4			AN6-36A	BOLT
15	6			MS21042L6	NUT (OR MS21042-6)
16	18			AN960JD616	WASHER
20		2		* D2940-1	SUPPORT
21		4		* D3595-063-530	RUBBER CUSHION
22		4		* MS21920-28	CLAMP (OR MS21042-30)
23		4		AN6-40A	BOLT
24		2		AN6-41A	BOLT
25		6		MS21042L6	NUT (OR MS21042-6)
26		18		AN960JD616	WASHER
30			1	* D2896-1	SUPPORT
32			2	* D3595-063-570	RUBBER CUSHION
33			4	* MS21920-28	CLAMP
34			2	* MS21920-30	CLAMP (OR MS21042-32)
35			4	AN6-40A	BOLT
36			2	AN6-41A	BOLT
37			6	MS21042L6	NUT (OR MS21042-6)
38			18	AN960JD616	WASHER
39			2	* D3189-1	CHAFING SHIELD
50	1	1		D3428-1	PLACARD

*REFERENCE ONLY. PARTS ARE INCLUDED IN D212-664-141/-241 OR D412-664-243 ASSEMBLIES ABOVE
 NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AAI
 SKIDTUBES.